

Roland SERVICE INFORMATION
SERVICE DEPARTMENT

NO.	100229
DATE	Dec. 21, 1984

PRODUCT AFFECTED: JUNO-106/MKS-30/GR-700

TO SERVICE ENGINEERS:
SUBJECT
IC AIQ-80017 FOR JUNO-106/MKS-30/GR-700

Recently there are many IC(AIQ-80017) faults on JUNO-106.
So we checked this IC and found the following trouble points.

- 1) Obfected IC Lot: 41C and 42B lots
- 2) Problem: Leakage between jump wire and -15V line on IC.
Poor soldering.
Surface leakage etc....
- 3) Countermeasure: Must be replaced with the new one
(the other lot).

So when you meet to repair the above model, please check this
and replace it with the new one if necessary.

