

PRODUCT AFFECTED: **GM - 7 0**

TO SERVICE ENGINEERS: **SUBJECT**  
**PROM VERSION UP**

PROBLEM :

GM-70 will send the unexpected Mode message in the specified combination of Branch when the Patch was changed.

I.E.	Patch 1	Branch A	CH=1	POLY
		B	CH=2	POLY
		C	CH=OFF	POLY
		D	CH=OFF	POLY
	Patch 2	Branch A	CH=2	MONO
		B	CH=OFF	POLY
		C	CH=OFF	POLY
		D	CH=OFF	POLY

When you change the Patch from Patch 1 to Patch 2, you expect GM-70 send Mono mode message to the slave unit(CH=2). However, in this case, GM-70 will send POLY mode after sending MONO mode.

If the setting of Patch 1 is as follows, there is no problem.

Patch 1	Branch A	CH=2	POLY
	B	CH=1	POLY
	C	CH=OFF	POLY
	D	CH=OFF	POLY

CAUSE : Software bug

CHANGE : PROM Ver. 1.02 to Ver. 1.03  
( 1579803 PROM A(27C128) / 15179804 PROM B(27C128))

EFFECTIVE : xx6150 up