

Roland SERVICE INFORMATION

SERVICE DEPARTMENT

NO

100212

DATE

Nov. 16, 1983

PRODUCT AFFECTED:

G-505

TO SERVICE ENGINEERS:

SUBJECT

COUNTERMEASURE FOR A NOISE


SOLUTION

This information (modification) is effective to such a noise which will happen on GR-505 (at MODE 1/DIST. and MODE 2/DIST. & VCO) when the fingers touch "VIBRATO touch switch" on the playing.

G-505 has already been improved with the serial number 352350 and this information should be applied to G-505 guitars with the serial numbers 352349 and before.

MODIFICATION

Two ceramic condensers 0.01uF must be added on G-505 . pre-amp board as shown below.

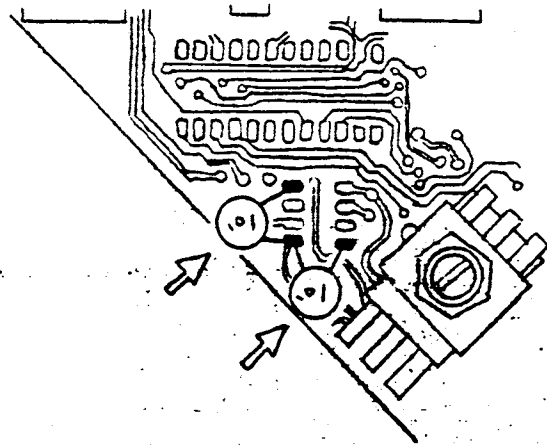

1/52

US (2), RCA (2), DK (4), Sweden, Norway, UK,
W.G, Canada, Swiss, France, Spain, Italy,
Austria, BLX₀₁, Mexico, New Zealand, Finland
Greece, Swee Lee, Tom Lee