


07/06/95

323
213-721 4875

3100

ELECTRONIC
MUSICAL
INSTRUMENTS

ATTN: JONATHAN PRINCE

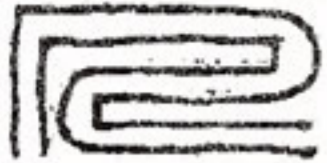

Roland Corporation

WE DON'T HAVE ANY HUMBUCKING
PICK UPS FOR YOUR G-808 (I PHYSICALLY
WENT OUT TO PARTS DEPT. TO CHECK)

THE PART #'S ARE
2238360901
11 11 11 02

MARK
WIPE

ATTN : SERVICE DEPT

RE : CHANGE PICK-UP FOR GR GUITARS

We inform you that we have changed the pick-up type and can't get the old one (#601) anymore.

Old type : #601 pick-up 22380601
New type : #610 pick-up 22385610

objected serial no. for old pick-up :

G-202	before serial no.	411600
G-303	"	413100
G-505	"	412600
G 808	"	413100

When you meet aboves, please order new type pick-up and change resistor value as follows.

CHANGE


1. change resistor value (for feedback) on the PREAMP Board.

* G-303, G-505, G-808 (See fig 1)
R19 : 1M → 100K
R12 : 330K → 33K

* G-202 (See fig 2)
R8 : 330K → 33K

Note) Take above modification to all channel (1-6), referring to our Service Notes

2. Fig. 3 (for only G-202/G-505)

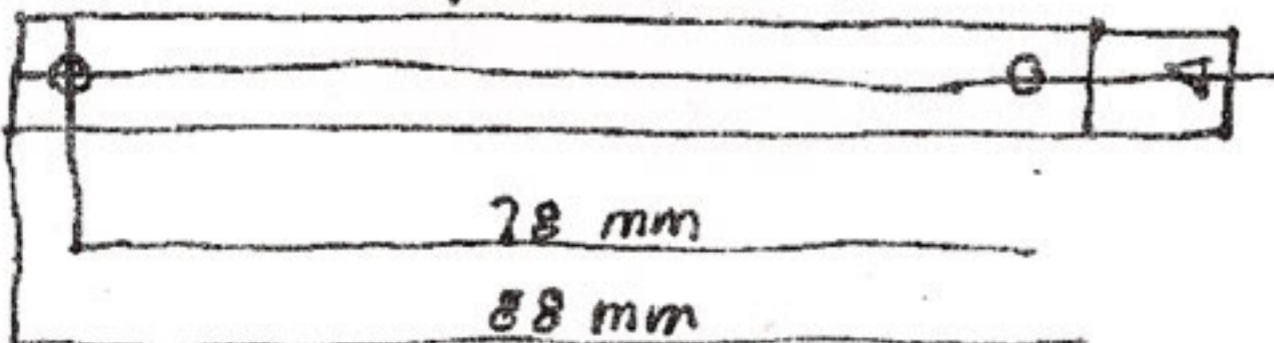

601 / A = 10mm
610 / A = 12mm

shave about 2mm to guitar body and pick guard which is fitted the